PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

	OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	A. BU			(X3) DATE COMPI	
		185259	B. WII	VG_		07/	29/2010
	PROVIDER OR SUPPLIER AVEN OF PROSPECT	<u> </u>		6	REET ADDRESS, CITY, STATE, ZIP CODE 301 BASS ROAD PROSPECT, KY 40059		LOTEOTO
(X4) ID PREFIX TAG	(EACH DEFICIENCY	ATEMENT OF DEFICIENCIES / MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREF TAG		PROVIDER'S PLAN OF CORRECTI (EACH CORRECTIVE ACTION SHOUI CROSS-REFERENCED TO THE APPRO DEFICIENCY)	LD BE	(X5) COMPLETION DATE
K 000	INITIAL COMMEN	rs	K	000			
1 1 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	concluded on July 2 Title 42, Code of Fe The facility was four with NFPA 101 Life Deficiencies were of identified at "F" leve NFPA 101 LIFE SA Corridors are separated with at rating. In sprinklere required to resist the non-sprinklered built above the ceiling. (at the underside of opermitted by Code, waiting areas, dining may be open to the conditions specified be separated from owalls if the gift shop 19.3.6.1, 19.3.6.2.1, This STANDARD is Based on observation failed to ensure that would not interfere was according to life safe deficient practice affermoke compartment.	ated from use areas by walls least ½ hour fire resistance d buildings, partitions are only a passage of smoke. In dings, walls properly extend Corridor walls may terminate ceilings where specifically Charting and clerical stations, a rooms, and activity spaces corridor under certain in the Code. Gift shops may orridors by non-fire rated is fully sprinklered.) 19.3.6.5 not met as evidenced by: n and interview, the facility a room open to the corridor lith egress requirements ty code standards. This exted one (1) of seven (7) is, staff and approximately	K	017	K-017 Red marking strips here been install to designate the opath area of egress in the The Area. This area will not be use for any type of temporary or permanent storage. Locks have been removed from the doub doors leading into the Theraparea. The current Therapy species was approved by the State Fi Marshall as part of the Out P Rehab Agency Licensure proof Therapy staff have been in serviced on the importance of keeping the path of egress cleobstruction. The therapy area be added to the daily Housekeeping Supervisors darounds checklist. Rehab Marand Administrator will monit daily compliance. Completion Date August 12,	clear crapy used ave le by bace re tatient beess. f ear of a will aily mager tor for	
1	* ` ' .	. The facility has the	A 2011 F 20 57		TITLE		(X6) DATE

Any deficiency statement ending with an asterist (a) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

AUG 2 0 2010

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391


	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	1'''	LE CONSTRUCTION	(X3) DATE SURVEY COMPLETED	
			A. BUILDING	01 - MAIN BUILDING 01		
		185259	B. WING		07/29/2010	
	PROVIDER OR SUPPLIER	,	63	EET ADDRESS, CITY, STATE, ZIP CODE 01 BASS ROAD ROSPECT, KY 40059		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES 'MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	FIX (EACH CORRECTIVE ACTION SHOULD BE		(X5) COMPLETION DATE
K 017		ge 1 ds with a census of 89 the day	K 017			•
	The findings include	9:				
	at 11:15am, with the therapy room was o south corridor. A seled to the therapy robolt type lock at the the contents of the raccess to a required. The fire marshal's o September 15, 2003 on this door and oth exits throughout the Director of Maintenaremove all the locks Maintenance was nowhich the therapy ro	ot aware the corridor area in nom was located did not meet ents and could no longer be				
	by partitions complyi 19.3.6.5. (See also 1 Exception No. 1: Sn protected throughout automatic sprinkler s 19.3.5.3 shall be per are unlimited in size provided that the follo(a) The spaces are prooms, treatment roc					

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

 If continuation sheet Page 2 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391


STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING 185259 07/29/2010 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 6301 BASS ROAD **BRITTHAVEN OF PROSPECT** PROSPECT, KY 40059 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PREFIX PROVIDER'S PLAN OF CORRECTION (X5) COMPLETION DATE (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION) PREFIX (EACH CORRECTIVE ACTION SHOULD BE TAG CROSS-REFERENCED TO THE APPROPRIATE TAG DEFICIENCY) K 017 Continued From page 2 K 017 the same smoke compartment are protected by an electrically supervised automatic smoke detection system in accordance with 19.3,4, or the smoke compartment in which the space is located is protected throughout by quick-response sprinklers. (c) The open space is protected by an electrically supervised automatic smoke detection system in accordance with 19.3.4, or the entire space is arranged and located to allow direct supervision by the facility staff from a nurses ' station or similar space. (d) The space does not obstruct access to required exits. 7.5.1.1 Exits shall be located and exit access shall be arranged so that exits are readily accessible at all times. K 018 NFPA 101 LIFE SAFETY CODE STANDARD K 018 K-018 The facility Maintenance SS=E Director will install magnet catches Doors protecting corridor openings in other than on the patient rooms doors in required enclosures of vertical openings, exits, or rooms listed below; hazardous areas are substantial doors, such as those constructed of 134 inch solid-bonded core wood, or capable of resisting fire for at least 20 4,6,7,10,15,19,22,24,26,31,33,34, minutes. Doors in sprinklered buildings are only 35, and 51 required to resist the passage of smoke. There is no impediment to the closing of the doors. Doors are provided with a means suitable for keeping And any other patient room doors the door closed. Dutch doors meeting 19.3.6.3.6 that do not stay open without the are permitted. 19.3.6.3 catches. Roller latches are prohibited by CMS regulations in all health care facilities. All waste receptacles will be removed from the location of holding these doors open.

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

 If continuation sheet Page 3 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

	IT OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	A. BU	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01		(X3) DATE SURVEY COMPLETED	
	•	185259	B. Wil	NG_		07/2	9/2010
	PROVIDER OR SUPPLIER AVEN OF PROSPECT	·		STREET ADDRESS, CITY, STATE, ZIP CO 6301 BASS ROAD PROSPECT, KY 40059			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREF TAG		PROVIDER'S PLAN OF CORREC (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APPI DEFICIENCY)	OULD BE	(X5) COMPLETION DATE
K 018	Continued From pa	ge 3	K)18	K018 continued;		·
	Based on observation failed to ensure that the closing of corridors the closing of corridors. The findings include During the Life Safety July 29, 2010, at 9:3 Maintenance, reside noted to have a was of the open door. We was removed the dointerview at this time maintenance directors should be no impediately of the survey with waste open include, but not 6, 7, 10, 15, 19, 22, 20 At 10:40am, the commoted to have ventilated of the doors in the open urse's station. Ventilately in these rooms to helicitize from affecting according to the doors in the open urse's station.	ty Code tour conducted on Oam, with the Director of on troom corridor door 33 was the receptacle located in front then the waste receptacle or would slowly close. An revealed that the raws unaware that there ment to closing of doors corridor doors noted during the receptacles holding doors timited to resident rooms 4, 24, 26, 31, 33, 34, 35 and 51. The puter and med. room were the tion vents in the bottom half then area of the facility at the illation vents cannot be used prevent smoke in case of cess to exits. An interview of Maintenance was not ment.			The doors in all patient roo be checked daily by the Maintenance Director or the Housekeeping Supervisor to that the doors are not obstruction closing. The administrator will more doors daily during rounds for compliance Completion Date: August 2010 The door vent grills in the Medication Room, and the Computer Equipment room been covered and sealed with rated drywall. Completion Date: August 2010	e o ensure ucted itor the for tall, have the fire	

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MUL A. BUILD	TIPLE CONSTRUCTION	(X3) DATE SURVEY COMPLETED	
		405050	B. WING	or man bombino or		
NAME OF I	PROVIDER OR SUPPLIER	185259	<u> </u>	TREET ADDRESS, CITY, STATE, ZIP CODE	07/2	29/2010
BRITTH	AVEN OF PROSPECT			6301 BASS ROAD PROSPECT, KY 40059		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES 'MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRE (EACH CORRECTIVE ACTION SH CROSS-REFERENCED TO THE APP DEFICIENCY)	OULD BE	(X5) COMPLETION DATE
K 025 SS=F	A.19.3.6.3.3 Doors should not be door stops, chocks, plunger-type devices necessitate manual to close. Examples or release when the dofriction catches or manual to close. Examples or release when the dofriction catches or manual to close. Examples or release when the dofriction catches or manual to close. Examples or the second to catches or manual to close. Examples or the used in these exception: Doors to shower rooms, sink spaces that do not combustible material ventilating louvers or NFPA 101 LIFE SAF Smoke barriers are cleast a one half hour accordance with 8.3. terminate at an atriur protected by fire-rate panels and steel fram separate compartme floor. Dampers are not beneficions of smoke the stops of smoke the compartment of smo	that release when the door is all be permitted. blocked open by furniture, tie-backs, drop-down or s, or other devices that unlatching or releasing action of hold-open devices that for is pushed or pulled are lagnetic catches. filles. ardless of whether they are link-operated dampers, shall walls or doors. toilet rooms, bathrooms, closets, and similar auxiliary ontain flammable or is shall be permitted to have to be undercut. ETY CODE STANDARD constructed to provide at fire resistance rating in Smoke barriers may m wall. Windows are d glazing or by wired glass nes. A minimum of two ints are provided on each of required in duct e barriers in fully ducted and air conditioning systems.	K 025		hecked for and operly wiring oke en at least	

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 5 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

	IT OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULT	TIPLE CONSTRUCTION ,	(X3) DATE SURVEY COMPLETED		
		DENTI IOATION ROWDER.	A. BUILDII	NG 01 - MAIN BUILDING 01			
		185259	B. WING_	701716110-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-	07/2	29/2010	
	PROVIDER OR SUPPLIER AVEN OF PROSPECT		(REET ADDRESS, CITY, STATE, ZIP CODE 6301 BASS ROAD PROSPECT, KY 40059		.0/2010	
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRI (EACH CORRECTIVE ACTION SI CROSS-REFERENCED TO THE AP DEFICIENCY)	IOULD BE	(X5) COMPLETIO DATE	
F 8 8 8 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	This STANDARD is Based on observation failed to maintain so one-half hour fire reached to above fire/smoke be sealed. This deficie of seven (7) smoke the residents. The facility failed to above fire/smoke be sealed. This deficie of seven (7) smoke the residents. The facility beds with a central facility of the findings include the findings include the findings include the findings include the fire/smoke barried cross-corridor doors, must be properly massmoke from spreadir facility. During the second of the fire spreadir facility. During the second of the fire spreadir doors were controlled to the facility. The spreadir facility of the fire spreadir doors and smoke barried for spreadir ducts, pneumatic for the facility of the spread spreading service equiples or sand smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled with a matter the facility of the space between the smoke barrier shall be filled to the space of	s not met as evidenced by: on and interview, the facility noke barriers with at least a sistance rating as required. ensure that penetrations arrier doors were properly nt practice affected seven (7) compartments, staff and all facility has the capacity for sus of 89 the day of survey. The Code survey on July 29, with the Director of led penetrations around duit and holes were noted in or wall above the dining hall or Fire/smoke barrier walls intained to prevent fire and ong to other areas of the curvey five (5) other cross observed with this type of crview revealed the Director not aware these penetrations by sealed. The 2000 edition as, bus ducts, cables, wires, subes and ducts, and similar order that pass through riers shall be protected as an the penetrating item and	K 025	K-025 continued; The Maintenance Director make weekly checks of the areas for continued proper maintenance of the smoked barriers, and will inspect a if necessary any area immediately following a repair or instation an outside contractor that affect the integrity of the strice barrier. Completion Day: August 2010	te attic re / fire and repair diately llation by may smoke /		

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 6 of 17

AUG 2 0 2010

DEFISION OF REALIS CASE PROBLEMS &

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

	NT OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	1	iultipl Ilding	E CONSTRUCTION 01 - MAIN BUILDING 01	(X3) DATE S COMPL	
		185259	B. WI	1G		07/2	29/2010
	PROVIDER OR SUPPLIER	·		630	ET ADDRESS, CITY, STATE, ZIP CODE 1 BASS ROAD OSPECT, KY 40059		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES 'MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFI TAG		PROVIDER'S PLAN OF CORRE (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APP DEFICIENCY)	OULD BE	(X5) COMPLETION DATE
	2. Be protected by a for the specific purp (b) Where the pene penetrate the smoke solidly set in the smith between the item ar 1. Be filled with a mathe smoke resistance. Be protected by a for the specific purp (c) Where designs to into consideration, and 1. Be made on eithe 2. Be made by an application of the specific purpose NFPA 101 LIFE SAF Required automatically condition and are insperiodically. 19.7.6 19.7.5 19.	an approved device designed ose. Itrating item uses a sleeve to be barrier, the sleeve shall be oke barrier, and the space and the sleeve shall aterial capable of maintaining the of the smoke barrier, or approved device designed ose. The smoke barrier is a side of the smoke barrier, or oproved device designed for the smoke barrier, or oproved device designed for the smoke barrier, or oproved device designed for the smoke barrier is side of the smoke barrier. The sprinkler systems are need in reliable operating	KO	62	K-062 The five noted sprinkler he the attic have been cleared blown in insulation and al attic sprinklers have been to ensure that they are free obstructions. The Mainte Director has checked all of sprinkler heads in the built where needed, they were of paint and drywall mud, cleaning was not possible, were replaced by our spring system contractor. Completion Date; August 2010	d of all l other checked e of any nance ther ding and cleaned if they nkler	

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 7 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF AND PLAN OF C		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MU A. BUIL	JLTIPLE CONSTRUCTION DING 01 - MAIN BUILDING 01	(X3) DATE S	
		185259	B. WING		07/2	9/2010
	/IDER OR SUPPLIER			STREET ADDRESS, CITY, STATE, ZIP CC 6301 BASS ROAD PROSPECT, KY 40059		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF COI (EACH CORRECTIVE ACTION CROSS-REFERENCED TO THE DEFICIENCY)	SHOULD BE	COMPLETION DATE
Reference of the six free Manuel of the six f	ic area in the souvered with blown exprinkler heads erview at this time ector revealed the months ago to he ezing in that area aintenance was not re covered with inference: NFPA 1 (3.5.3* Obstruction charge from Reantinuous or noncorrupt the water director in a manner ching the protectes section. Terence: NFPA 2 (3.5.3* Obstruction in a manner change from Reantinuous or noncorrupt the water director in a manner ching the protectes section. Terence: NFPA 2 (3.5.3* Obstruction in a manner ching the protectes section. Terence: NFPA 2 (4.5.3* Obstruction in a manner ching the protectes section. Terence: NFPA 2 (4.5.3* Obstruction in a manner ching the protectes section.	prinkler heads located in the th corridor were noted to be in insulation. This would keep from reacting as intended. An ewith the maintenance insulation was added about elp keep sprinkler piping from the Director of ot aware the sprinkler heads insulation. 3 (1999 edition). s that Prevent Sprinkler ching the Hazard ischarge in a horizontal plane 7 mm) below the sprinkler for to limit the distribution from ed hazard shall comply with the distribution from ed hazard shall comply with the sprinklers shall be free of aterials, paint, and physical installed in the proper ght, pendant, or sidewall). The proper ght, pendant, or sidewall installed, loaded, or in the improper ety CODE STANDARD shers are provided in all cies in accordance with	K 06	62		

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 8 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391


STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MUL A. BUILD	TIPLE CONSTRUCTION ING 01 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED	
		185259	B. WING		07/2	29/2010
	PROVIDER OR SUPPLIER AVEN OF PROSPECT			IREET ADDRESS, CITY, STATE, ZIP CODE 6301 BASS ROAD PROSPECT, KY 40059		
(X4) ID PREFIX TAG	TIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL		ID PREFIX TAG	PROVIDER'S PLAN OF CORRE (EACH CORRECTIVE ACTION SH CROSS-REFERENCED TO THE API DEFICIENCY)	IOULD BE	(X5) COMPLETION DATE
K 064	K 064 Continued From page 8		K 064	K-064		
	Based on observation failed to ensure the portable fire extingular The findings included During the Life Safe at 10:45am, with the Class-K portable fire to be located in the extinguisher is designable back up alternative is suppression system.	ty Code tour on July 29, 2010, a Director of Maintenance, a extinguisher was noted not kitchen area. This type of fire yield for grease fires and is a to the range-hood fire. An interview at this time Maintenance revealed that he		A new Class K portable extinguisher has been installed Kitchen area near the range and a placard has beinstalled by the fire extinuthat reads "that the fire processes on the range is to activated prior to using the extinguisher". Completion Date Augus 2010	stalled in cooking been guisher rotection be ne fire	
	Reference: NFPA 1	0 1998 edition				
	cooking appliances t	ovided for the protection of hat use combustible cooking animal oils and fats) shall be Class K fires.		K-069		
K 069 SS=D	near the extinguished protection system sh the fire extinguisher. NFPA 101 LIFE SAF Cooking facilities are	all be conspicuously placed r that states that the fire all be activated prior to using ETY CODE STANDARD protected in accordance S, NFPA 96	K 069	A new ten inch stainless s baffle has been installed o side of the range to separa range from the deep fryer. baffle covers the side widt range.	n the te the The	:

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 9 of 17

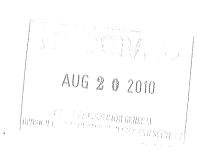

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	A. BUIL	DING	E CONSTRUCTION 01 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED 07/29/2010	
		185259	B. WIN	G			
	PROVIDER OR SUPPLIER AVEN OF PROSPECT	г		STREET ADDRESS, CITY, STATE, Z 6301 BASS ROAD PROSPECT, KY 40059			
(X4) ID PREFIX TAG	(EACH DEFICIENC	ATEMENT OF DEFICIENCIES Y MUST BE PRECEDED BY FULL LSC IDENTIFYING INFORMATION)	ID PREFIX TAG	(PROVIDER'S PLAN OF CORRE (EACH CORRECTIVE ACTION SH CROSS-REFERENCED TO THE APP DEFICIENCY)	OULD BE	(X5) COMPLETIC DATE
	This STANDARD Based on observate failed to ensure kitch maintained as requestion. The findings include During the Life Safat 10:50am, with the revealed a deep fry range in the kitcher be separated or produced to be located to be located to the range hood. Ar Director of Maintenar requirements of the	is not met as evidenced by: ion and interview, the facility chen appliances were properly iired.	K 06				
	16-in. (406.4-mm) s surface flames from Exception: Where a baffle plate is installemm) in height betwee flames of the adjace 9-1.2.2* Cooking appliances be moved, modified, reevaluation of the fi	hall be installed with at least a pace between the fryer and adjacent cooking equipment. steel or tempered glass ed at a minimum 8 in. (203 pen the fryer and surface ent appliance. requiring protection shall not or rearranged without prior ire-extinguishing system by or servicing agent, unless of the					

FORM CMS-2567(02-99) Previous Versions Obsolete


Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 10 of 17





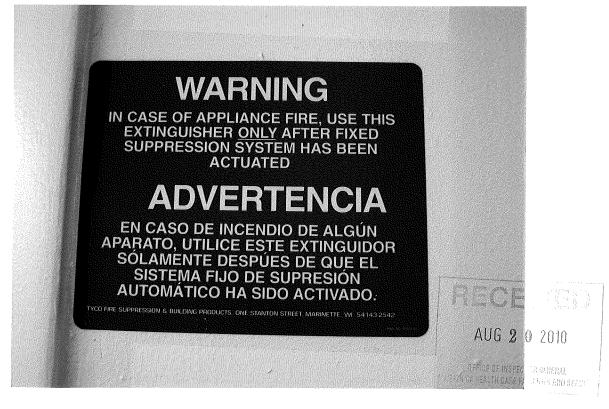

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MI A. BUIL	JLTIPLE CONSTRUCTION DING 01 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED	
		185259	B. WIN	G	07/29/2010	
	PROVIDER OR SUPPLIER			STREET ADDRESS, CITY, STATE, ZIP COL 6301 BASS ROAD PROSPECT, KY 40059		
(X4) ID PREFIX TAG	(EACH DEFICIENC)	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF COR ((EACH CORRECTIVE ACTION : CROSS-REFERENCED TO THE A DEFICIENCY)	SHOULD BE	(X5) COMPLETIO DATE
K 069	maintenance and c appliances are retu positioning prior to disconnected fire-e attached to the app	ge 10 appliances moved to perform leaning provided the rned to their original cooking operations, and any extinguishing system nozzles liances are reconnected in expanding the manufacturer's listed	K 0	69		
K 072 SS=E	system is affected to nozzles. For this reaccooking appliances which they were whe quipment was designable appliance is moved cleaning or any other replaced to its origin cooking operation. NFPA 101 LIFE SAIMEANS of all obstructions or use in the case of fit furnishings, decorations.	f an automatic extinguishing by the placement of the ason, it is essential that be situated in the area in en the extinguishing igned and installed. If an from under the equipment for er reason, it should be all position prior to initiating a FETY CODE STANDARD e continuously maintained free impediments to full instant re or other emergency. No ions, or other objects obstruct ess from, or visibility of exits.	K 07	Wheelchairs, Geri-Chair Lifts, Linen carts and of Care related equipment, stored in hallways. The are used throughout the part of routine patient care moved in and out of rooms during each shift never stored for any exterperiod of time in the hall Staff will be in serviced importance of maintaini egress down the hallway times.	her Patient will not be se items day as a are. They patient and are ended lways. on the ng clear	
	Based on observation failed to ensure that free from obstruction case of fire or other practice affected two	not met as evidenced by: on and interview, the facility corridors were maintained as to full instant use in the emergency. This deficient o (2) of seven (7) smoke and approximately twenty		The locks on the double leading into the dining rebeen removed. Completion Date; Aug 2010	oom have	

FORM CMS-2587(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 11 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

(X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION **IDENTIFICATION NUMBER:** COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING 185259 07/29/2010 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 6301 BASS ROAD **BRITTHAVEN OF PROSPECT** PROSPECT, KY 40059 PROVIDER'S PLAN OF CORRECTION SUMMARY STATEMENT OF DEFICIENCIES (X5) COMPLETION (X4) ID (EACH CORRECTIVE ACTION SHOULD BE PRÉFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL **PREFIX** DATE CROSS-REFERENCED TO THE APPROPRIATE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG TAG DEFICIENCY) K 072 K 072 Continued From page 11 (20) residents. The facility has the capacity for 100 beds with a census of 89 the day of survey. The findings include: During the Life Safety Code tour on July 29, 2010, at 9:00am, a linen cart, wheelchair, two lifts and a Geri-chair were noted to not be in use and unattended in the east corridor. At 11:00am, an interview with the Director of Maintenance revealed these same items were in use. An interview with a staff member at 11:10am revealed staff were aware these items needed to be stored out of the corridor when not in use. The staff member stated the linen cart routinely stayed in the corridor because there was not a designated place in the facility to store the linen cart. Corridors are intended for means of egress, internal traffic and emergency use, not storage spaces. The Life Safety Code has specific requirements for storage spaces. These items would also limit the use of the hand rails by occupants of the building when needed. At 11:30am a set of doors to the facility's dining area were noted to have a dead bolt type lock at the top of the door. These doors are part of a corridor exit and cannot be locked in this manner. The fire marshal's office cited the facility on September 15, 2003, for having this type of lock on this door and other doors that led to required exits throughout the facility. An interview with the Director of Maintenance revealed he forgot to remove all the locks. Reference: NFPA 101 2000 editon Doors shall be arranged to be opened readily

FORM CMS-2587(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 12 of 17



. N PECTOR GENERAL L.A. E FACILITIES AND SERVE.

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391


STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) M A. BU		IPLE CONSTRUCTION IG 01 - MAIN BUILDING 01	(X3) DATE S COMPL	
		185259	B. Wi	VG_		07/2	29/2010
	PROVIDER OR SUPPLIER AVEN OF PROSPECT			6	REET ADDRESS, CITY, STATE, ZIP CODE 301 BASS ROAD PROSPECT, KY 40059		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREF TAG		PROVIDER'S PLAN OF CORREC (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APPF DEFICIENCY)	ULD BE	(X6) COMPLETION DATE
K 072	from the egress side occupied. Locks, if use of a key, a tool, for operation from the NFPA 101 LIFE SAME Medical gas storage protected in accorda Standards for Health (a) Oxygen storage 3,000 cu.ft. are encloseparation.	e whenever the building is provided, shall not require the or special knowledge or effort ne egress side. FETY CODE STANDARD e and administration areas are ance with NFPA 99, or Care Facilities. locations of greater than		072	K-076 The current oxygen storage will be modified so that no than twelve E tanks, (less the cubic feet) will be stored in area at one time. On the day Life Safety Survey, full tanks were being storage area. We will design separate storage area near the of the building for temporar storage of empty containers they are picked up by the ox	more an 300 this y of the ks and red in gnate a he rear y until	
	Based on observation failed to ensure that according to NFPA sometimes. The findings include: During the Life Safet at 10:15am, with the forty two (42) E size of the stored in a room of the transmission of the storage and in quantificet must be kept five	y Code tour on July 29, 2010, Director of Maintenance, oxygen tanks were noted to next to the nurse's station.			provider. The current room modified so that there are no combustibles within five fee oxygen tanks. All tanks, em and full, will be stored in a rrack to prevent tipping. Completion Date; August 2 2010	will be of the opty netal	

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

 If continuation sheet Page 13 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO, 0938-0391


	T OF DEFICIENCIES OF CORRECTION			(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01			SURVEY .ETED
		185259	B. WI	NG_		07/2	29/2010
	PROVIDER OR SUPPLIER			6	REET ADDRESS, CITY, STATE, ZIP CODE 301 BASS ROAD PROSPECT, KY 40059		2010
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREF TAG		PROVIDER'S PLAN OF CORREC (EACH CORRECTIVE ACTION SHO CROSS-REFERENCED TO THE APPE DEFICIENCY)	ULD BE	(X5) COMPLETION DATE
	be located outside of compartment) at loc such as at a nurse 'healthcare facility. This amount of nonfismoke compartmenthe containers are prack to prevent them damaged. In this caconsidered an "ope storage. If the cylind they should be place use of the corridor. Is in addition to those crash carts " and in gurneys. The term "PRN" rindividual cylinder plainmediate use by a pattern to the cylinder plainmediate use by a pattern to the cylinder. If the use of oxygen for an such as several days container should be ropepely secured in a Reference: NFPA 983-3.1.11.2 Storage for nonflamma (300 ft3) but less A) Storage locations	feet may follow the C-07-10. 7-10 onflammable medical gas can of an enclosure (per smoke ations open to the corridor s station or in a corridor of a lammable medical gas per t is not considered a hazard if roperly secured, such as in a from tipping over or being se the medical gas is prational supply " and not ders are placed in a corridor of so as not to obstruct the This amount of medical gas ecylinders contained in " use on wheelchairs or means " as needed. " An aced in a patient room for patient is not required to be to end is considered in use. To prevent tipping or damage resident does not need the extended period of time, then the medical gas removed from the room and in approved storage room. The state of the storage room and the provent tipping or damage resident does not need the extended period of time, then the medical gas removed from the room and in approved storage room. The state of the storage room and the provent tipping or damage resident does not need the extended period of time, then the medical gas removed from the room and in approved storage room. The state of the sta	K	076			

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID; GUED21

Facility ID: 100430

 If continuation sheet Page 14 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES (X1) PR AND PLAN OF CORRECTION IDE		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	1	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01 B. WING		(X3) DATE SURVEY COMPLETED		
		185259	B. Wii					
NAME OF PROVIDER OR SUPPLIER BRITTHAVEN OF PROSPECT				STREET ADDRESS, CITY, STATE, ZIP CODE 6301 BASS ROAD PROSPECT, KY 40059				
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)			PREFIX (EACH CORRECTIVE ACTION		SHOULD BE COMPLÉTION		
K 147 SS=D	(EACH DEFICIENCY MUST BE PRECEDED BY FULL			ID PROVIDER'S PLAN OF CORRE PREFIX (EACH CORRECTIVE ACTION SH TAG CROSS-REFERENCED TO THE APP		CI) ed in the		
		not met as evidenced by: n and interview, the facility			Completion Date; August 2010	18,		

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 15 of 17



PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTI A. BUILDIN	PLE CONSTRUCTION IG 01 - MAIN BUILDING 01	(X3) DATE SURVEY COMPLETED	
		185259	B. WING		07/29/2010	
	PROVIDER OR SUPPLIER AVEN OF PROSPECT		6	REET ADDRESS, CITY, STATE, ZIP COD 301 BASS ROAD ROSPECT, KY 40059		
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG	PROVIDER'S PLAN OF COR (EACH CORRECTIVE ACTION S CROSS-REFERENCED TO THE A DEFICIENCY)	(X5) COMPLETION DATE	
K 147	The findings included During the Life Safe at 10:55am, with the revealed an electrical of the sink in the kith Ground Fault rated receptacles help preaccidental shock by areas. An interview	electrical wiring met NFPA	K 147			
	area of the wet locat circuit-interrupter projection of power be tolerated, or be substantial fixed, therapeutic and be permitted to be substantial fixed, therapeutic and be permitted to be substantial fixed, therapeutic and provided that a. Wiring for grounded not occupy the same b. All conductive surfigrounded. b. Where an isolated equipment shall be like	ns d fixed equipment within the ion shall have ground-fault bection for personnel if under fault conditions can erved by an isolated power uption cannot be tolerated, rcuits supplying only listed, d diagnostic equipment shall upplied from a normal upplied from a normal upplied or 3-phase system, ed and isolated circuits does raceway, and aces of the equipment are power system is utilized, the sted for the purpose and eets the provisions of and is				

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: GUED21

Facility ID: 100430

If continuation sheet Page 16 of 17



DEFICE OF THE THE CARLES OF THE DEFICE OF TH

PRINTED: 08/11/2010 FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTII A. BUILDING	PLE CONSTRUCTION G 01 - MAIN BUILDING 01	(X3) DATE (COMPL	(X3) DATE SURVEY COMPLETED	
		185259 B. WING			07/	07/29/2010	
	PROVIDER OR SUPPLIER AVEN OF PROSPECT		63	EET ADDRESS, CITY, STATE, ZIP CO 801 BASS ROAD ROSPECT, KY 40059		10/2010	
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PROVIDER'S PLAN OF CORP PREFIX (EACH CORRECTIVE ACTION S TAG CROSS-REFERENCED TO THE A DEFICIENCY)		HOULD BE COMPLETION		
K 147.	FPN: For requireme	ge 16 Ints for installation of Ind tubs, see Part F of Article	K 147				
		·					
		·					

K-069 BAFFLE PANEL ADDED TO STOVE TO SEBARATE FROM DEEP FRYER

